

RADIO CORPORATION PTY. LTD.

DIVISION OF ELECTRONIC INDUSTRIES LTD.

126-130 GRANT STREET, SOUTH MELBOURNE, S.C.4.

TECHNICAL BULLETIN

BULLETIN: GPS-2

File: Receivers

Portable

Date: 19-4-55.

MODEL "GPS" (1st Release)

It has been brought to our notice that there is a possibility of the handle on the Model ''GPS'' touching a piece of tinned copper wire which emerges through an eyelet in the chassis just under the handle assembly and earths one of the switch contacts. The screw through the bottom part of the handle bracket could catch this piece of tinned wire in such a way as to drag it upward and cause the handle to be effectively connected to the chassis. This applies only to the first release of the Model ''GPS'' with automatic reactivation. The receivers now being produced use a different circuit and a different assembly. Would all Service Station personnel please keep a check on this point, and ensure that the offending wire is well clear of the handle on all sets returned for service.